

CARDONE™ ProTech®

Supporting Today's Vehicle Technician




81-158PB Replacement Pulse Board Park Problem

Application CARDONE™ Wiper Motor Pulse Board part number 81-158PB. See catalog for proper vehicle applications.

Problem Wipers will not park after replacing Pulse Board.

Cause Contact arms on Pulse Board may not be contacting Wiper Motor. Packing material or movement during shipping may have bent contacts.

Solution Check position of contact arms before installation. Contacts should be approximately 1 inch (25 mm) above circuit board (see picture). Correct contact position ensures proper Wiper Motor parking function.

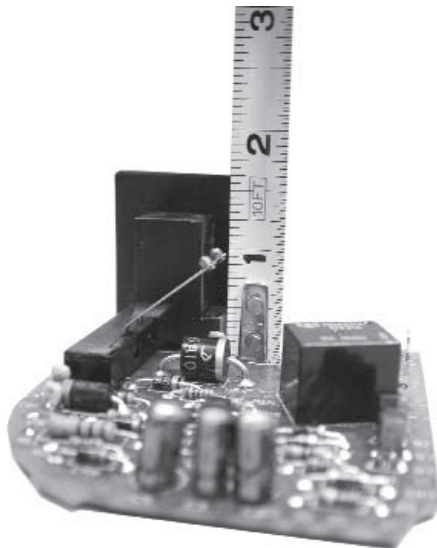

Note Refer to ProTech® PT 40-0003 and PT 40-0004 for additional troubleshooting tests for Wiper Motors and Pulse Boards.