

Technical Data Sheet

Permatex® Ultra Rubber Gasket Sealant & Dressing

PRODUCT DESCRIPTION

Permatex® Ultra Rubber Gasket Sealant & Dressing is a grey polymeric compound that forms a seal by solvent evaporation. It is a non-hardening, soft, pliable paste with an alcoholic odor. Ultra Rubber Gasket Sealant & dressing is developed for use on cut or molded rubber gaskets to hold them in place during reassembly. The product allows for unlimited repositioning.

S.I.N.: 834-300

PRODUCT BENEFITS


- No measuring or mixing
- · Eliminates "slippery" rubber gaskets
- Non-hardening for easy assembly and disassembly
- · Resists common automotive fluids
- · Corrosion, temperature and vibration proof
- Temperature range –65°F to +400°F

TYPICAL APPLICATIONS

 Automotive gasketing applications that require either cut rubber or molded rubber gaskets.

DIRECTIONS FOR USE

- 1. Clean flange surfaces thoroughly.
- Apply a thin film of Ultra Rubber Gasket Sealant to all sides of gasket.

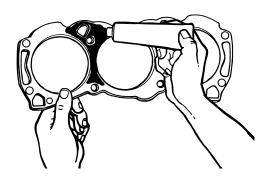

- 3. Allow to air dry for a few minutes until tacky.
- 4. Assemble and tighten.

PROPERTIES OF UNCURED MATERIAL

Chemical Type
Chemical Type
Appearance
Odor
Specific Gravity @77°F (25°C)
Viscosity
Flash Point, TCC, °F

Typical Value
Polymeric material
Grey paste
Alcoholic
1.3
Viscosity
Paste
Flash Point, TCC, °F

134

Chemical / Solvent Resistance

The product retains effective properties in contact with automotive fluids, such as fuel, motor oil, transmission fluids, alcohol and antifreeze solutions.

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Material Safety Data Sheet, (MSDS).

ORDERING INFORMATION

Part Number	Container Size
85409	1.0 oz. tube, carded

STORAGE

Products shall be ideally stored in a cool, dry location in unopened containers at a temperature between 8° and 28°C (46° and 82°F) unless otherwise labeled. Optimal storage is at the lower half of this temperature range. To prevent contamination of unused product, do not return any material to its original container.

PERMATEX PRODUCTS AUTO DETAILING